


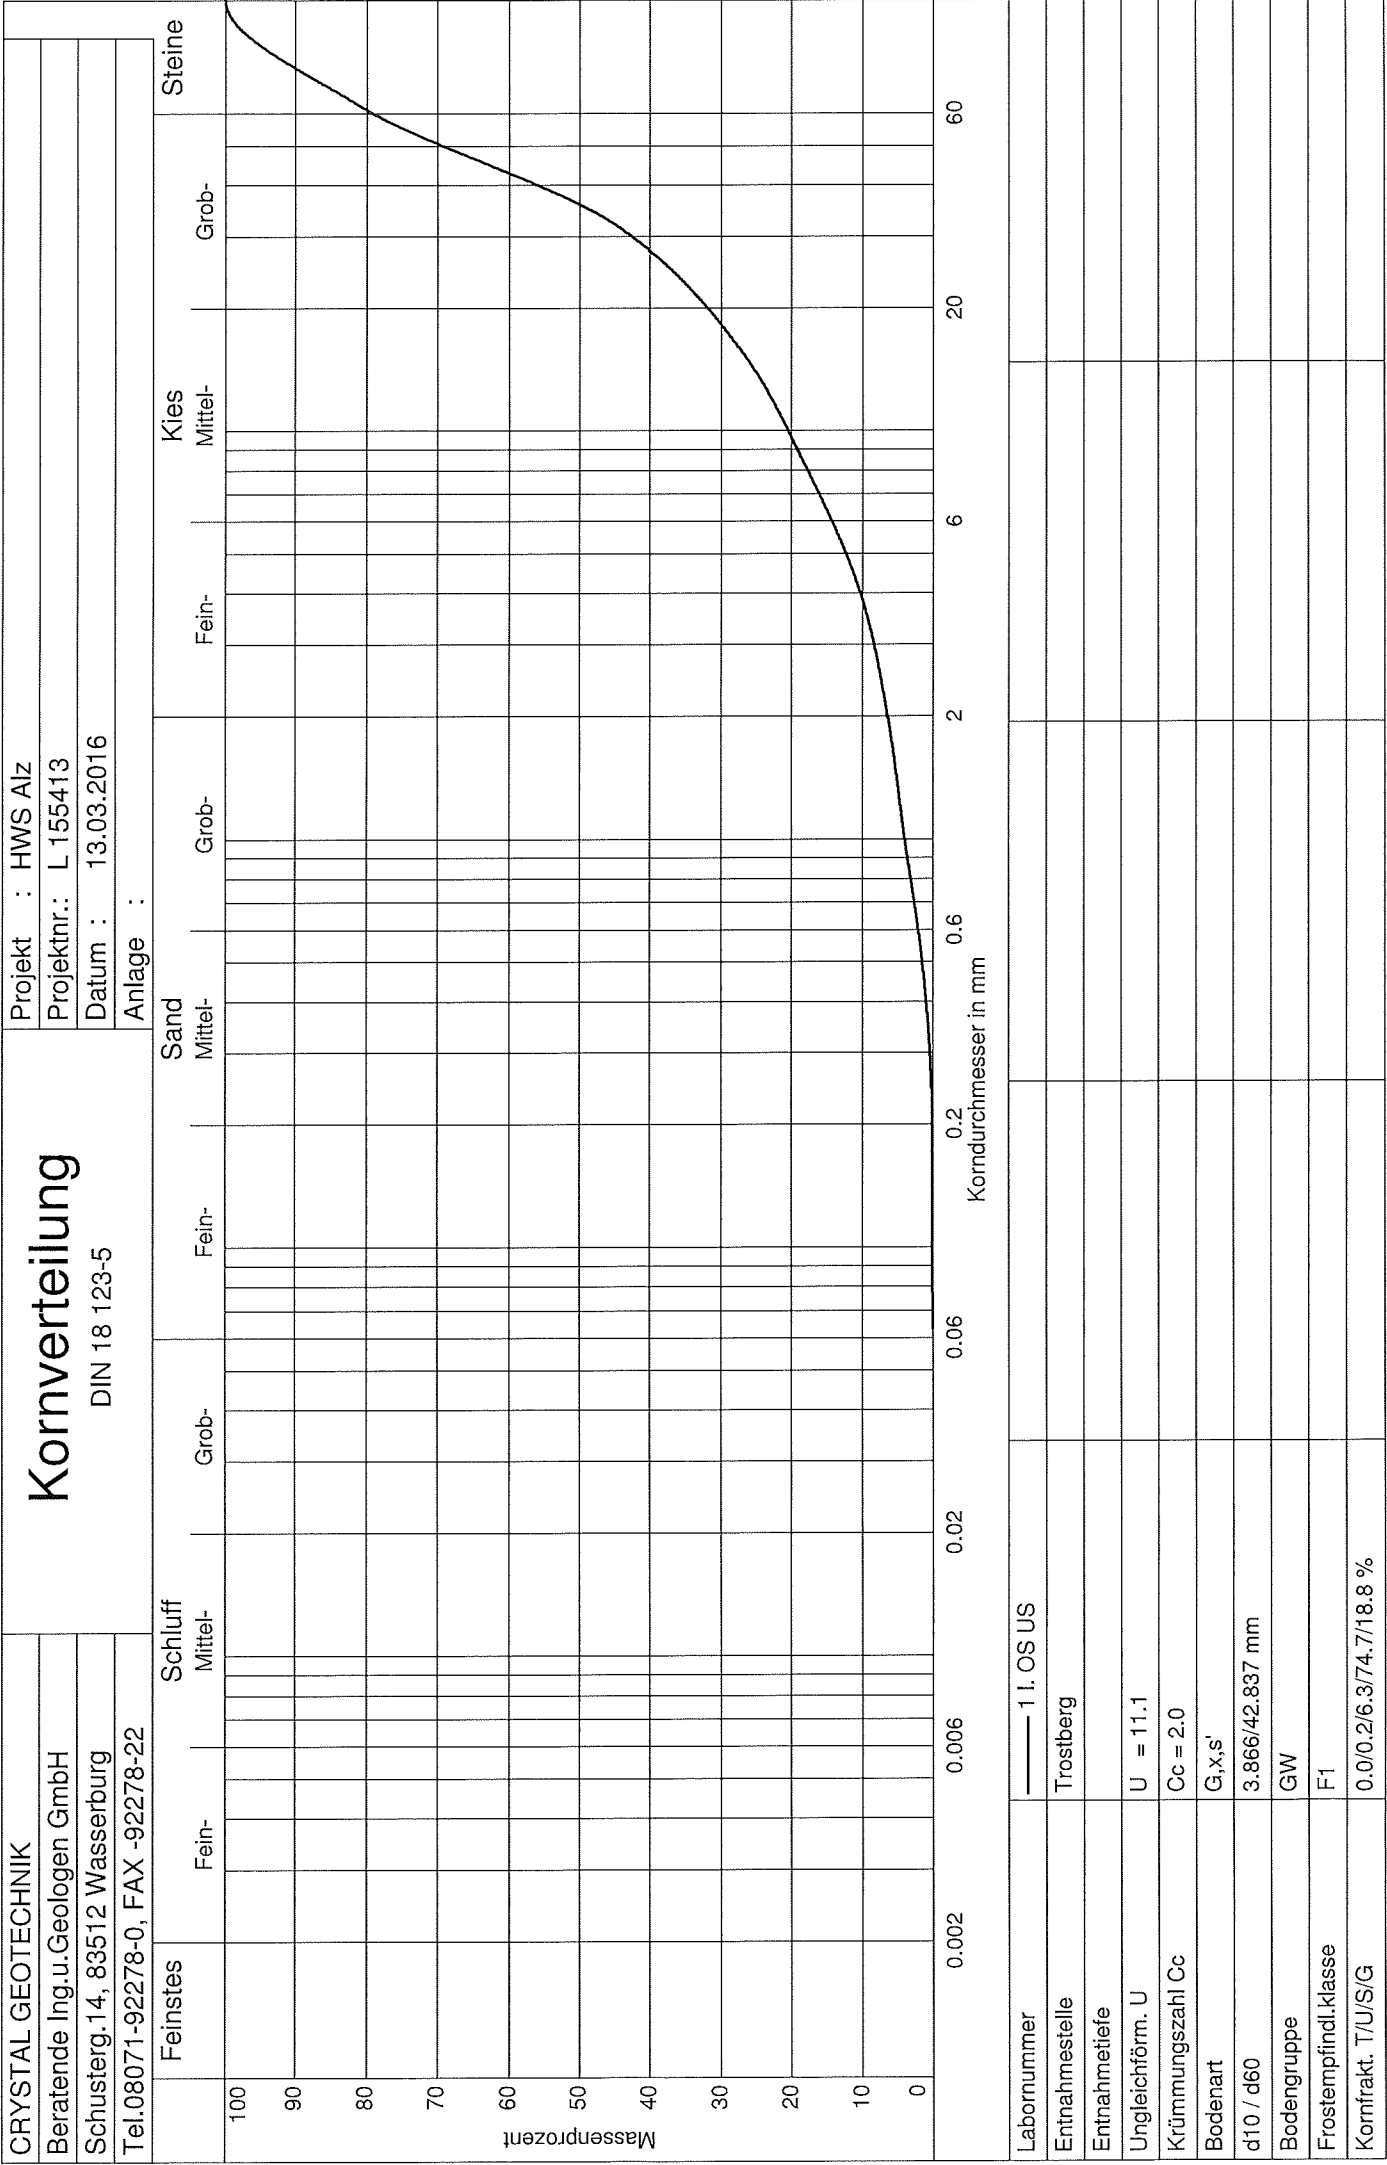


CRYSTAL GEOTECHNIK	Projekt : HWS Alz
Beratende Ing.u.Geologen GmbH	Projektnr.: L 155413
Schusterg.14, 83512 Wasserburg	Datum : 13.03.2016
Tel.08071-50051, FAX -40133	Anlage :

KORNVERTEILUNG

1 l. OS US

Entnahmestelle: Trostberg
Entnahmetiefe:

SIEBUNG					
Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]	Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]
0.000	0.2	0.0			
0.063	0.0	0.2	2.000	3.8	6.5
0.125	0.1	0.2	4.000	7.5	10.3
0.250	1.3	0.3	8.000	9.7	17.8
0.500	2.5	1.6	16.0	16.9	27.5
1.000	2.4	4.1	31.5	36.8	44.3
			63.0	18.8	81.2

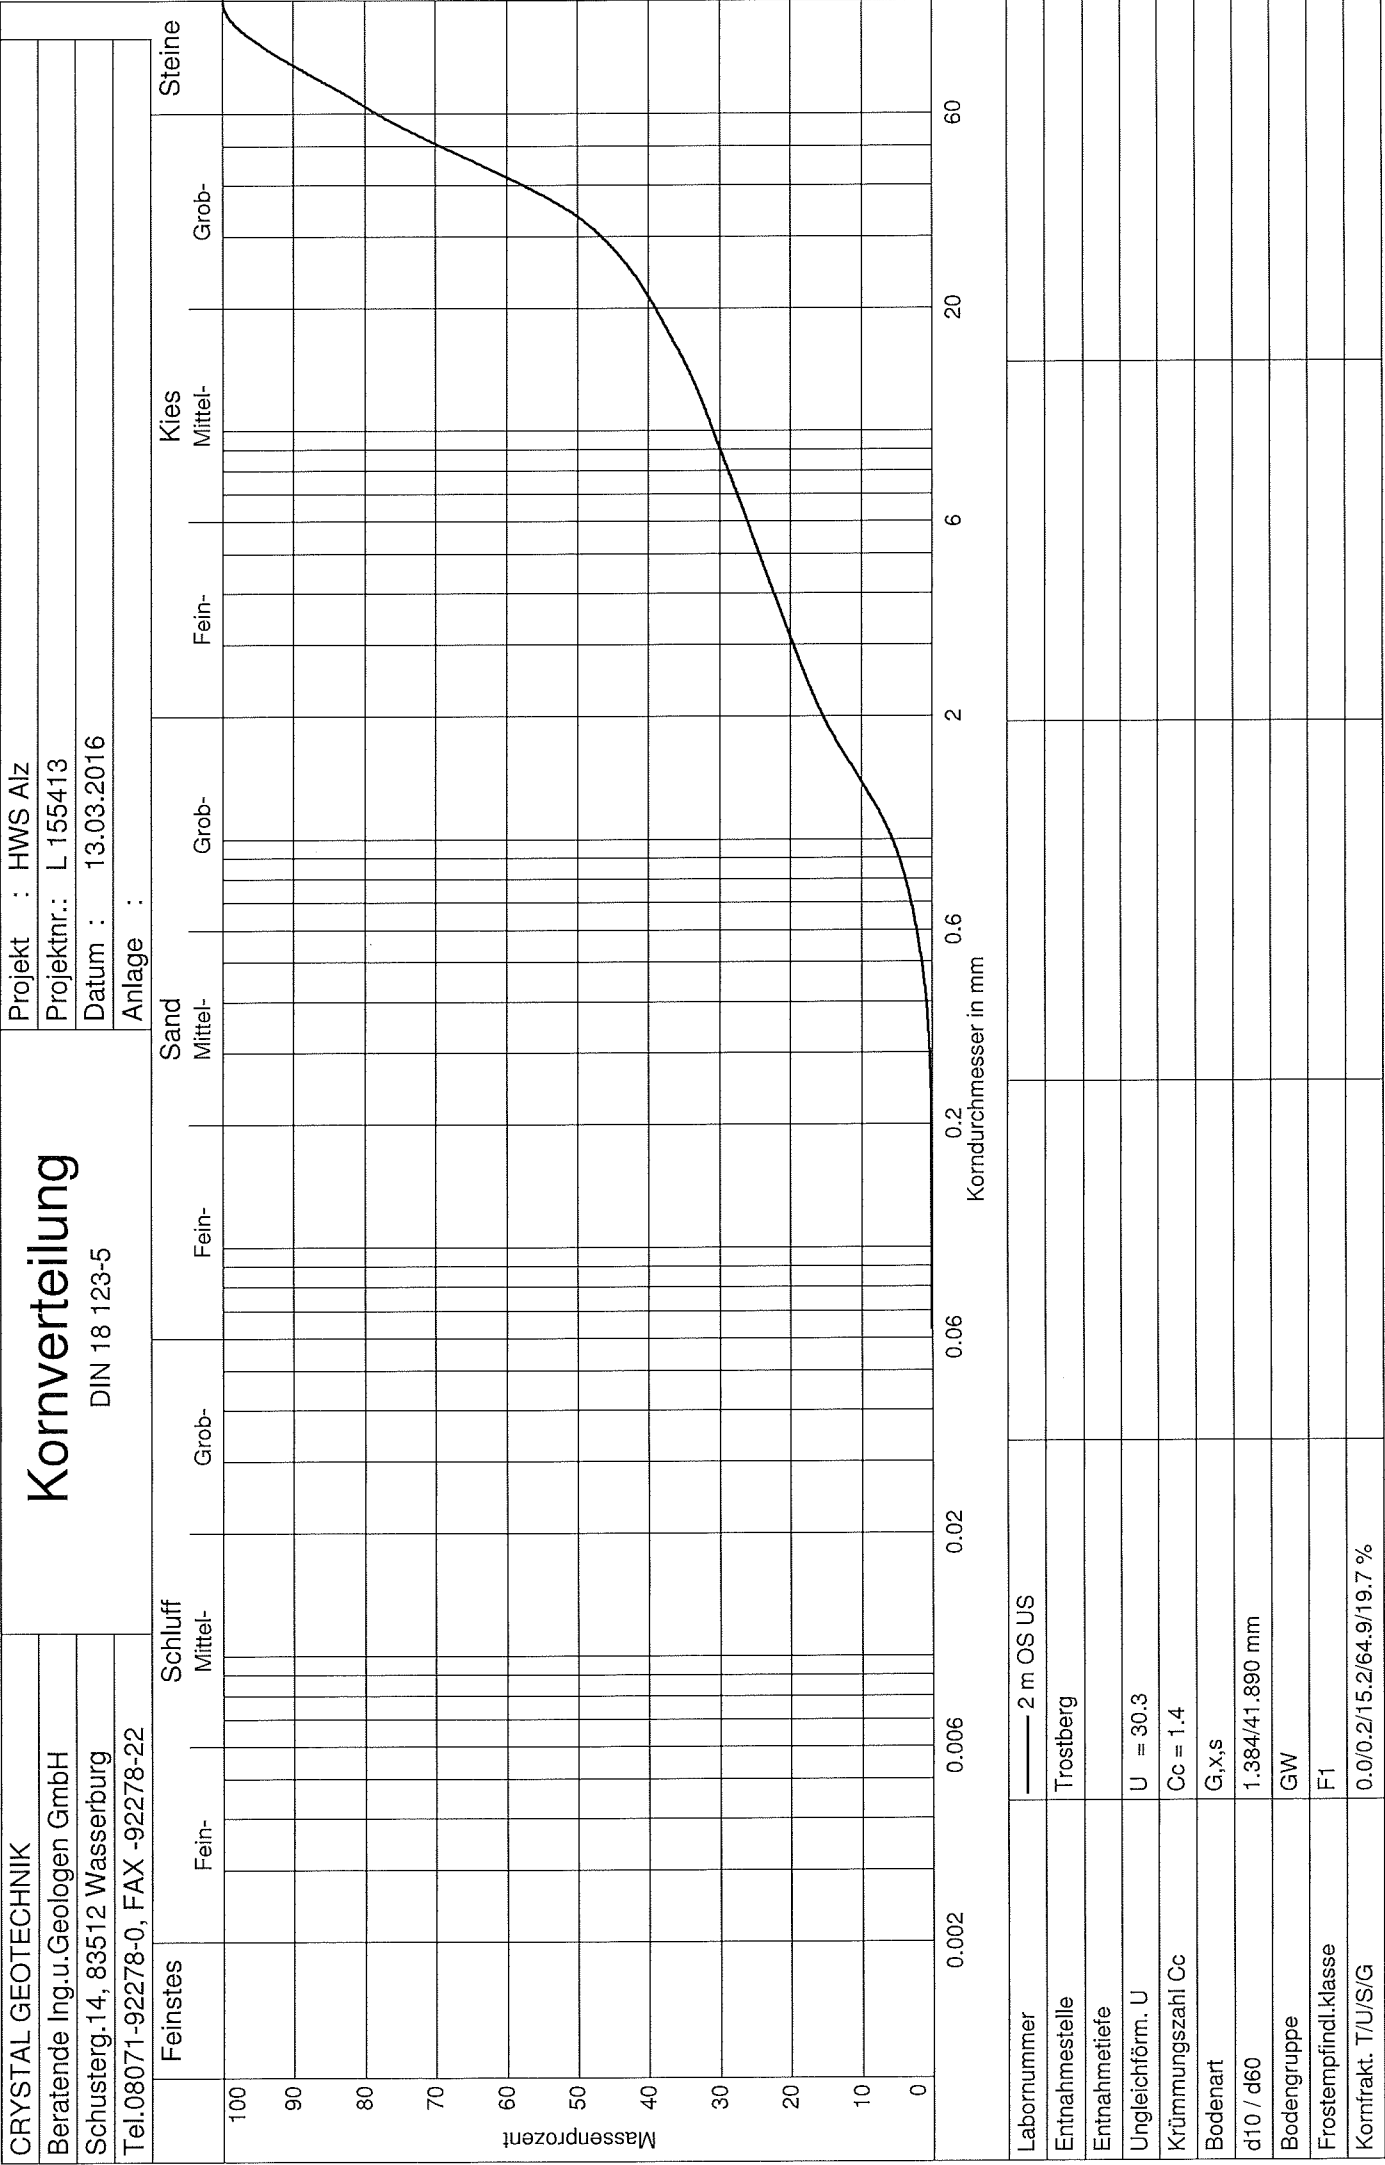



CRYSTAL GEOTECHNIK	Projekt : HWS Alz
Beratende Ing.u.Geologen GmbH	Projektnr.: L 155413
Schusterg.14, 83512 Wasserburg	Datum : 13.03.2016
Tel.08071-50051, FAX -40133	Anlage :

KORNVERTEILUNG

2 m OS US

Entnahmestelle: Trostberg
Entnahmetiefe:

SIEBUNG					
Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]	Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]
0.000	0.2	-0.0			
0.063	0.0	0.2	2.000	6.9	15.4
0.125	0.1	0.2	4.000	6.5	22.3
0.250	1.3	0.3	8.000	7.2	28.8
0.500	4.1	1.5	16.0	12.0	36.0
1.000	9.7	5.7	31.5	32.3	48.0
			63.0	19.7	80.3

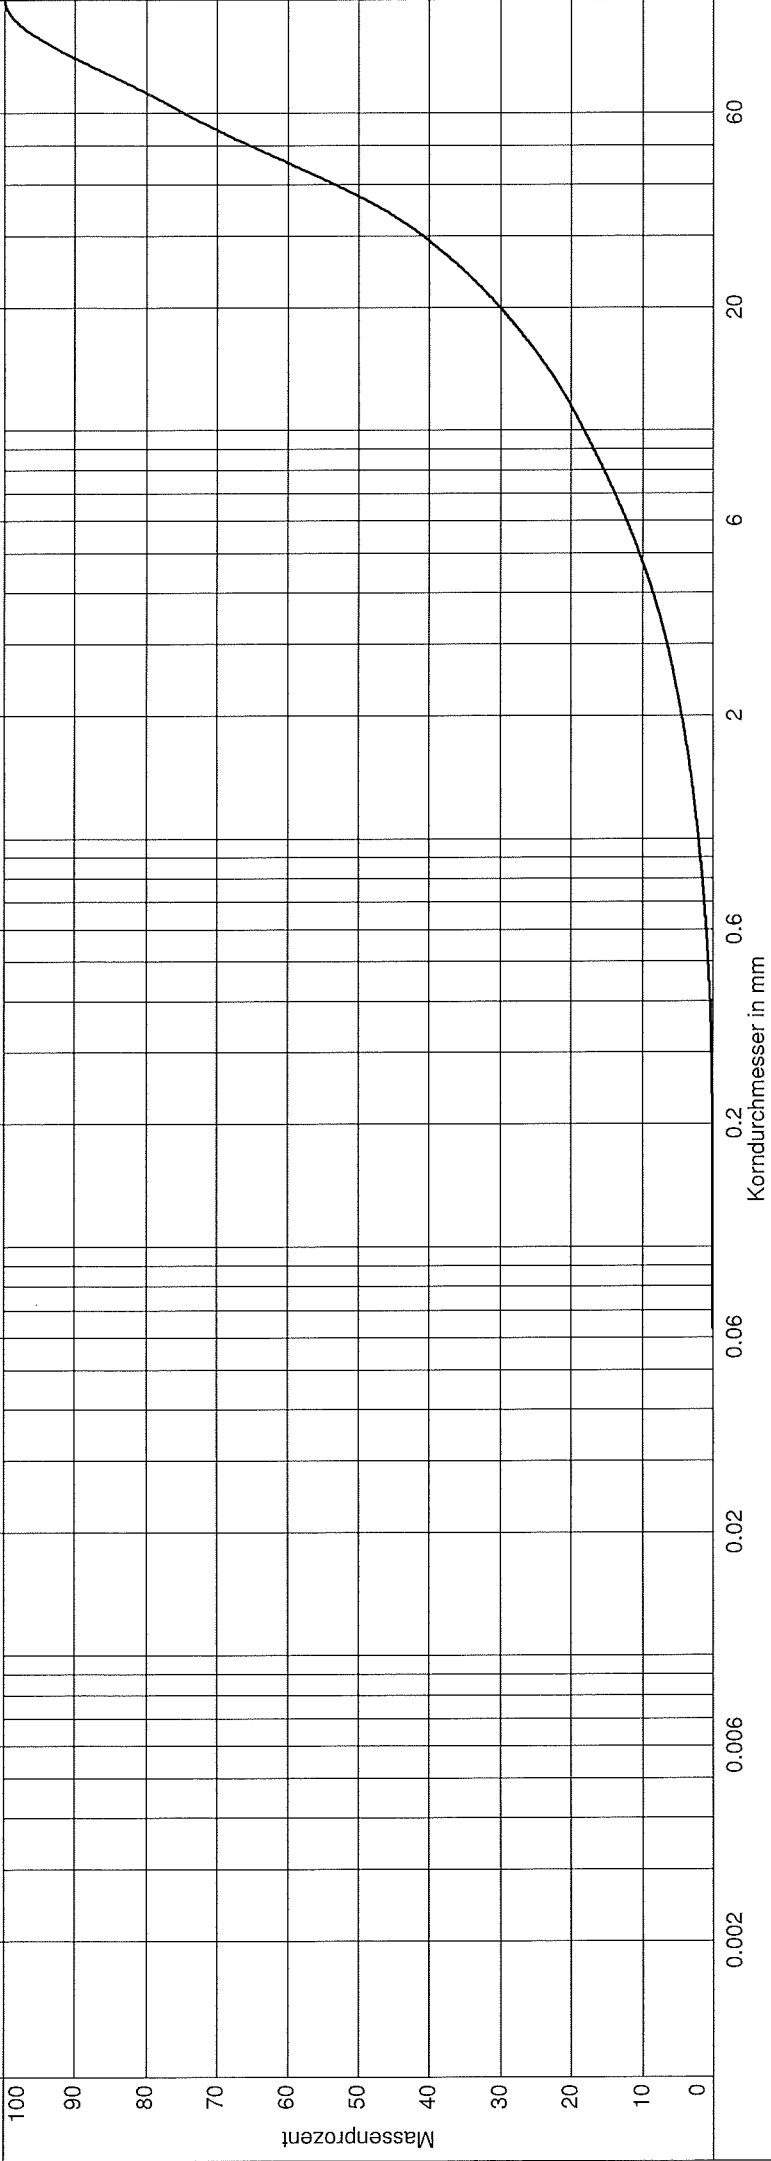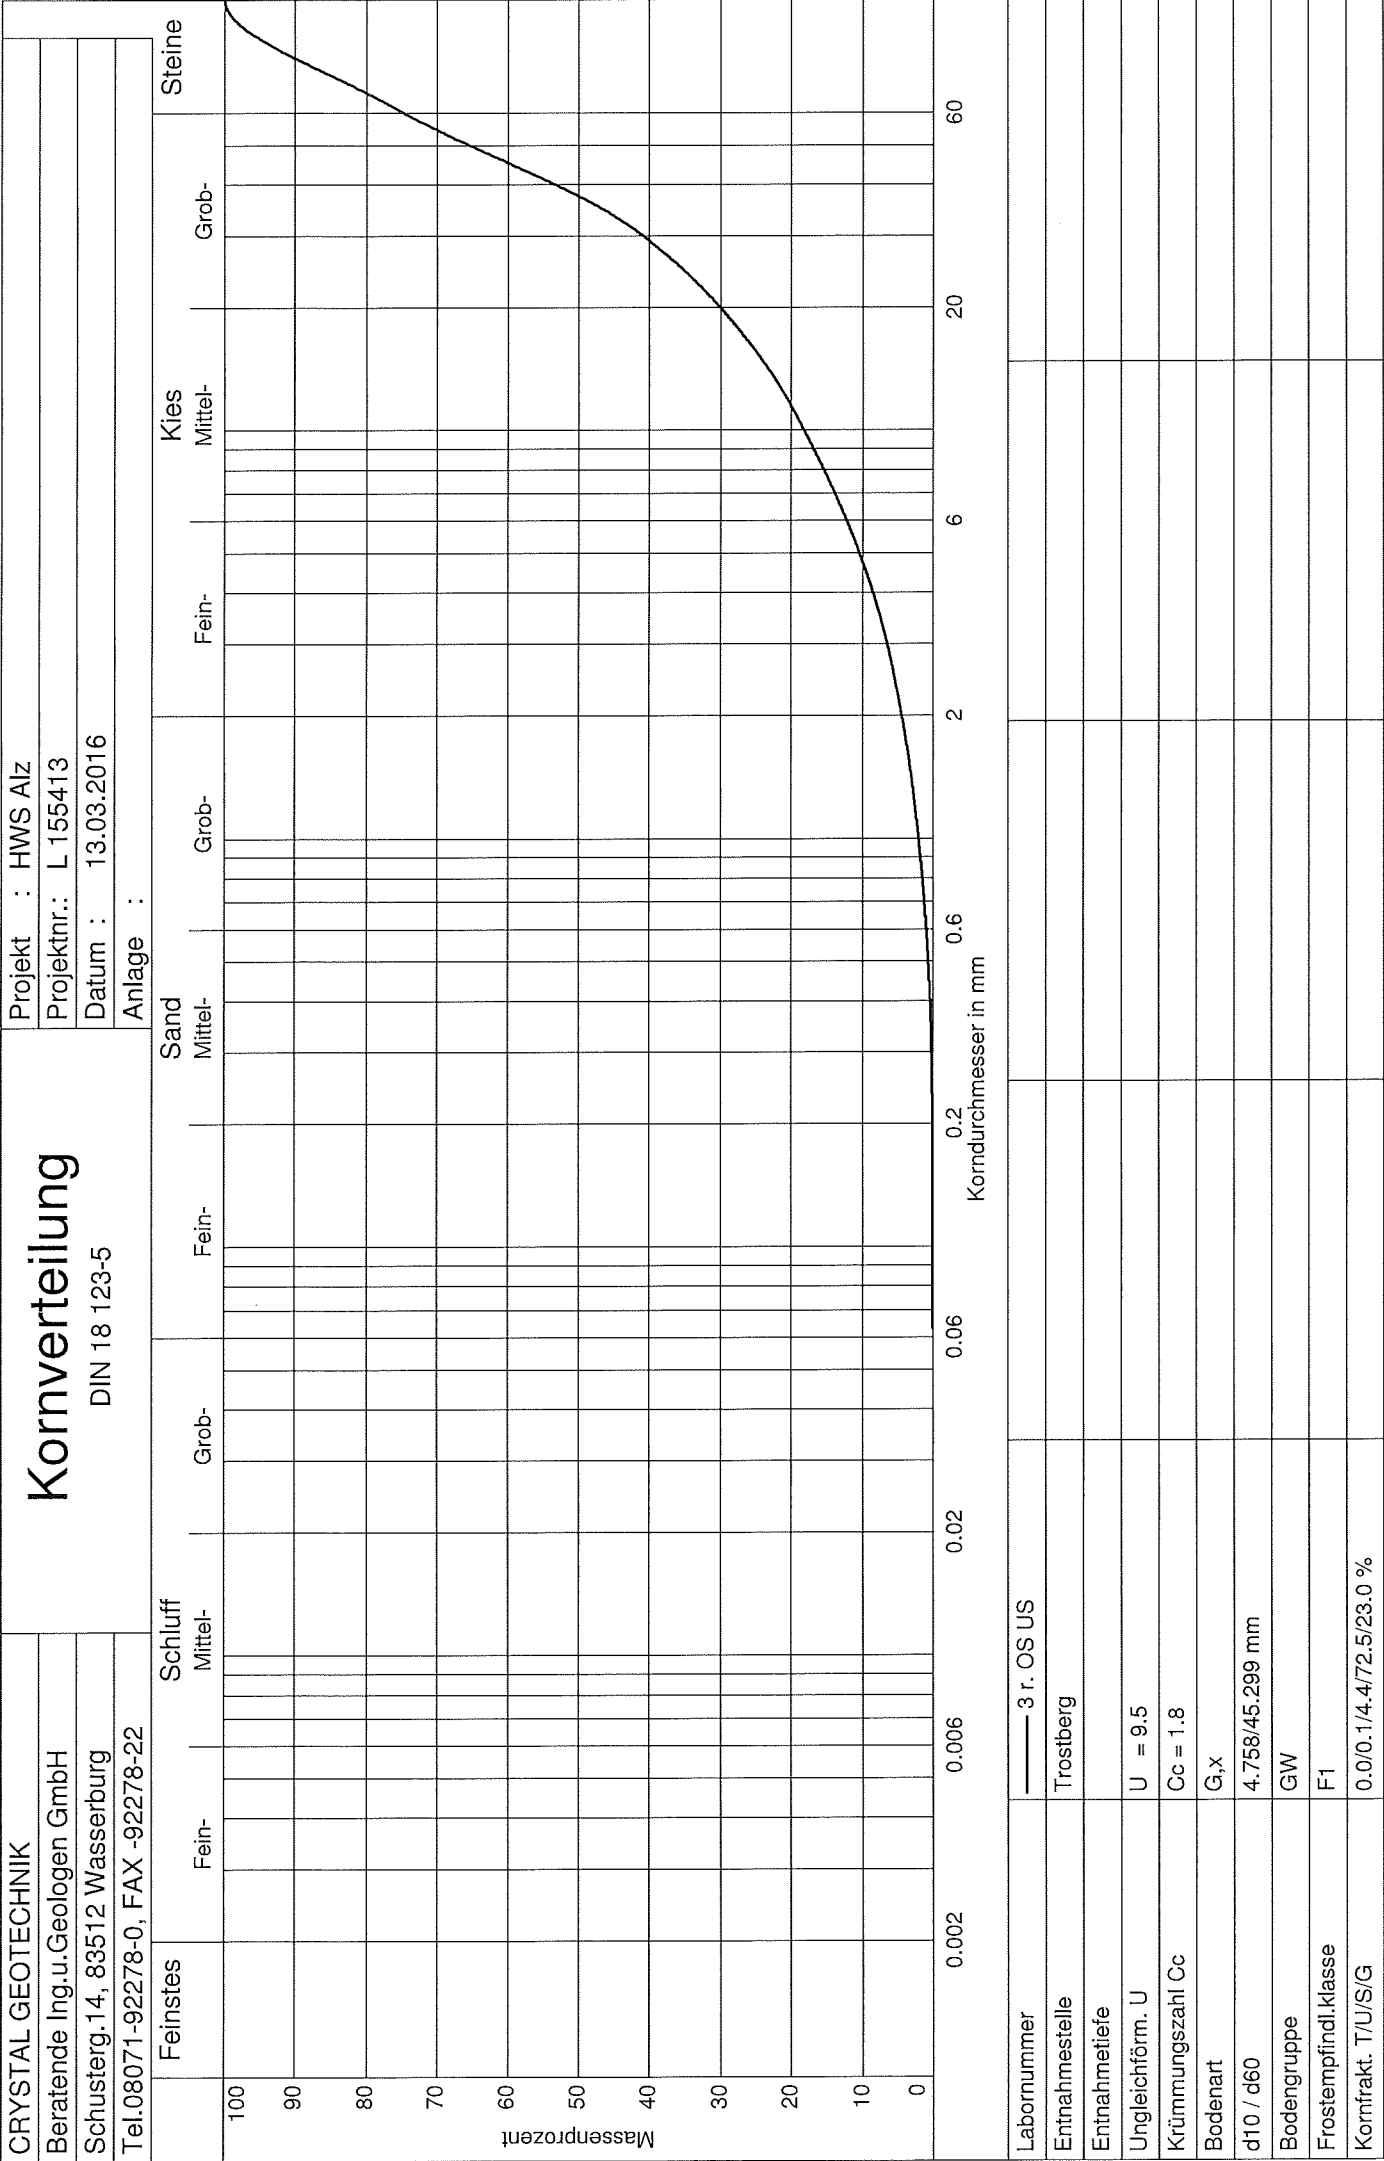


CRYSTAL GEOTECHNIK	Projekt : HWS Alz
Beratende Ing.u.Geologen GmbH	Projektnr.: L 155413
Schusterg.14, 83512 Wasserburg	Datum : 13.03.2016
Tel.08071-50051, FAX -40133	Anlage :

KORNVERTEILUNG

3 r. OS US

Entnahmestelle: Trostberg
Entnahmetiefe:

SIEBUNG					
Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]	Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]
0.000	0.1	0.0			
0.063	0.0	0.1	2.000	4.1	4.5
0.125	0.1	0.1	4.000	7.0	8.5
0.250	0.5	0.2	8.000	10.0	15.5
0.500	1.4	0.7	16.0	17.2	25.4
1.000	2.4	2.1	31.5	34.3	42.7
			63.0	23.0	77.0

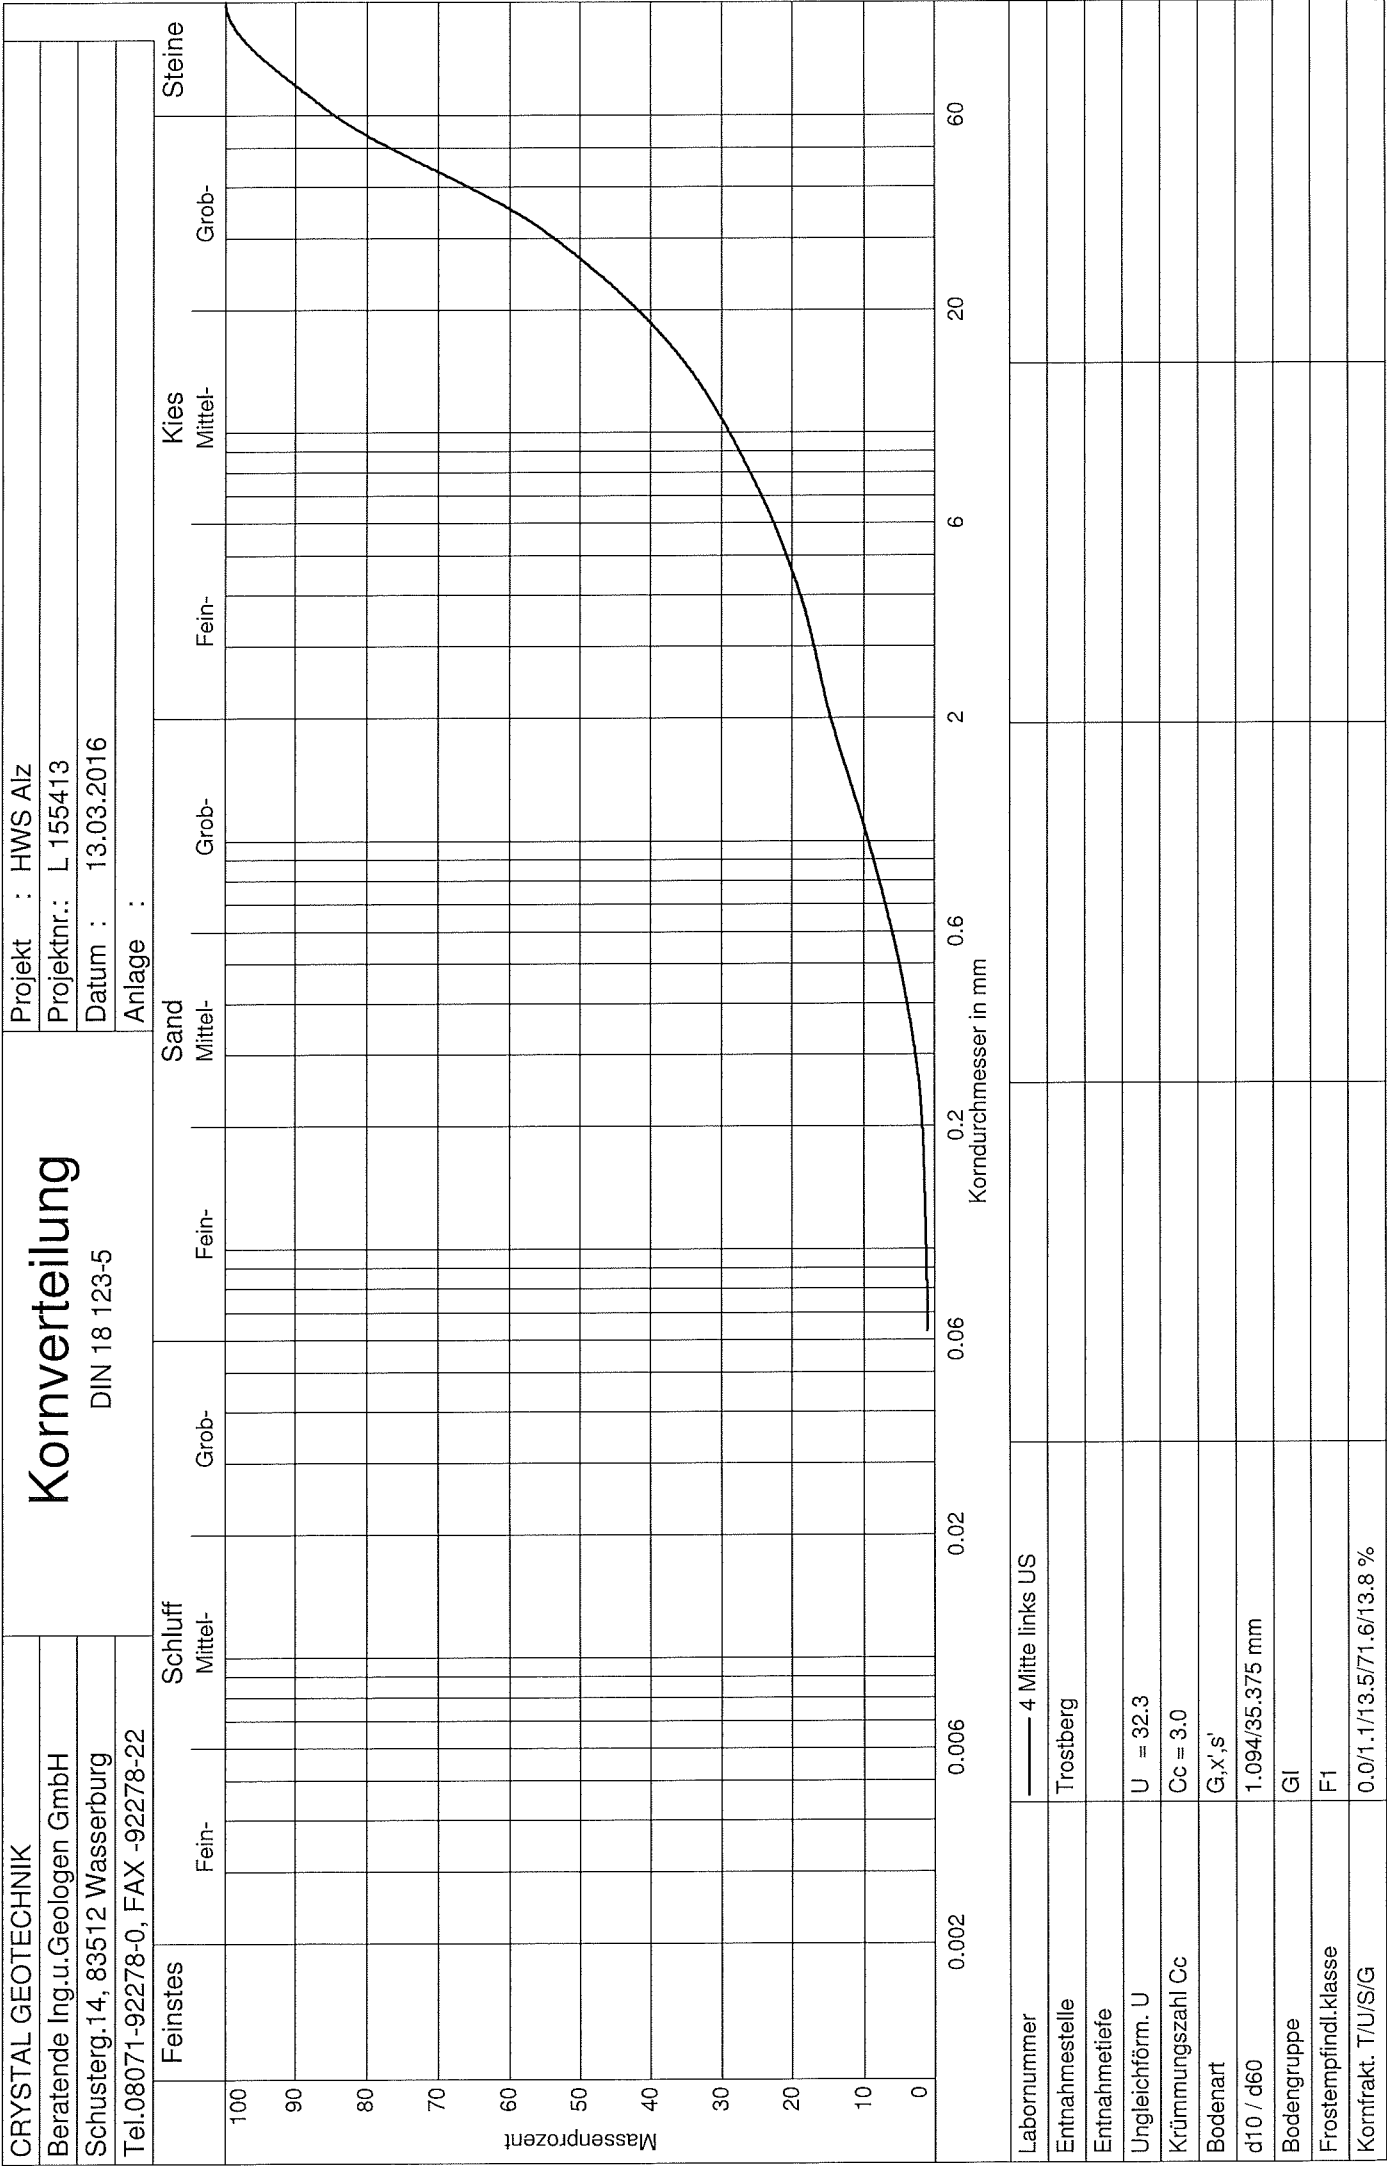


CRYSTAL GEOTECHNIK	Projekt : HWS Alz
Beratende Ing.u.Geologen GmbH	Projektnr.: L 155413
Schusterg.14, 83512 Wasserburg	Datum : 13.03.2016
Tel.08071-50051, FAX -40133	Anlage :

KORNVERTEILUNG

4 Mitte links US

Entnahmestelle: Trostberg
Entnahmetiefe:

SIEBUNG					
Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]	Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]
0.000	1.1	-0.0			
0.063	0.3	1.1	2.000	4.3	14.6
0.125	0.8	1.4	4.000	7.1	18.9
0.250	2.8	2.2	8.000	10.8	25.9
0.500	4.3	5.0	16.0	18.7	36.8
1.000	5.2	9.4	31.5	30.8	55.4
			63.0	13.8	86.2

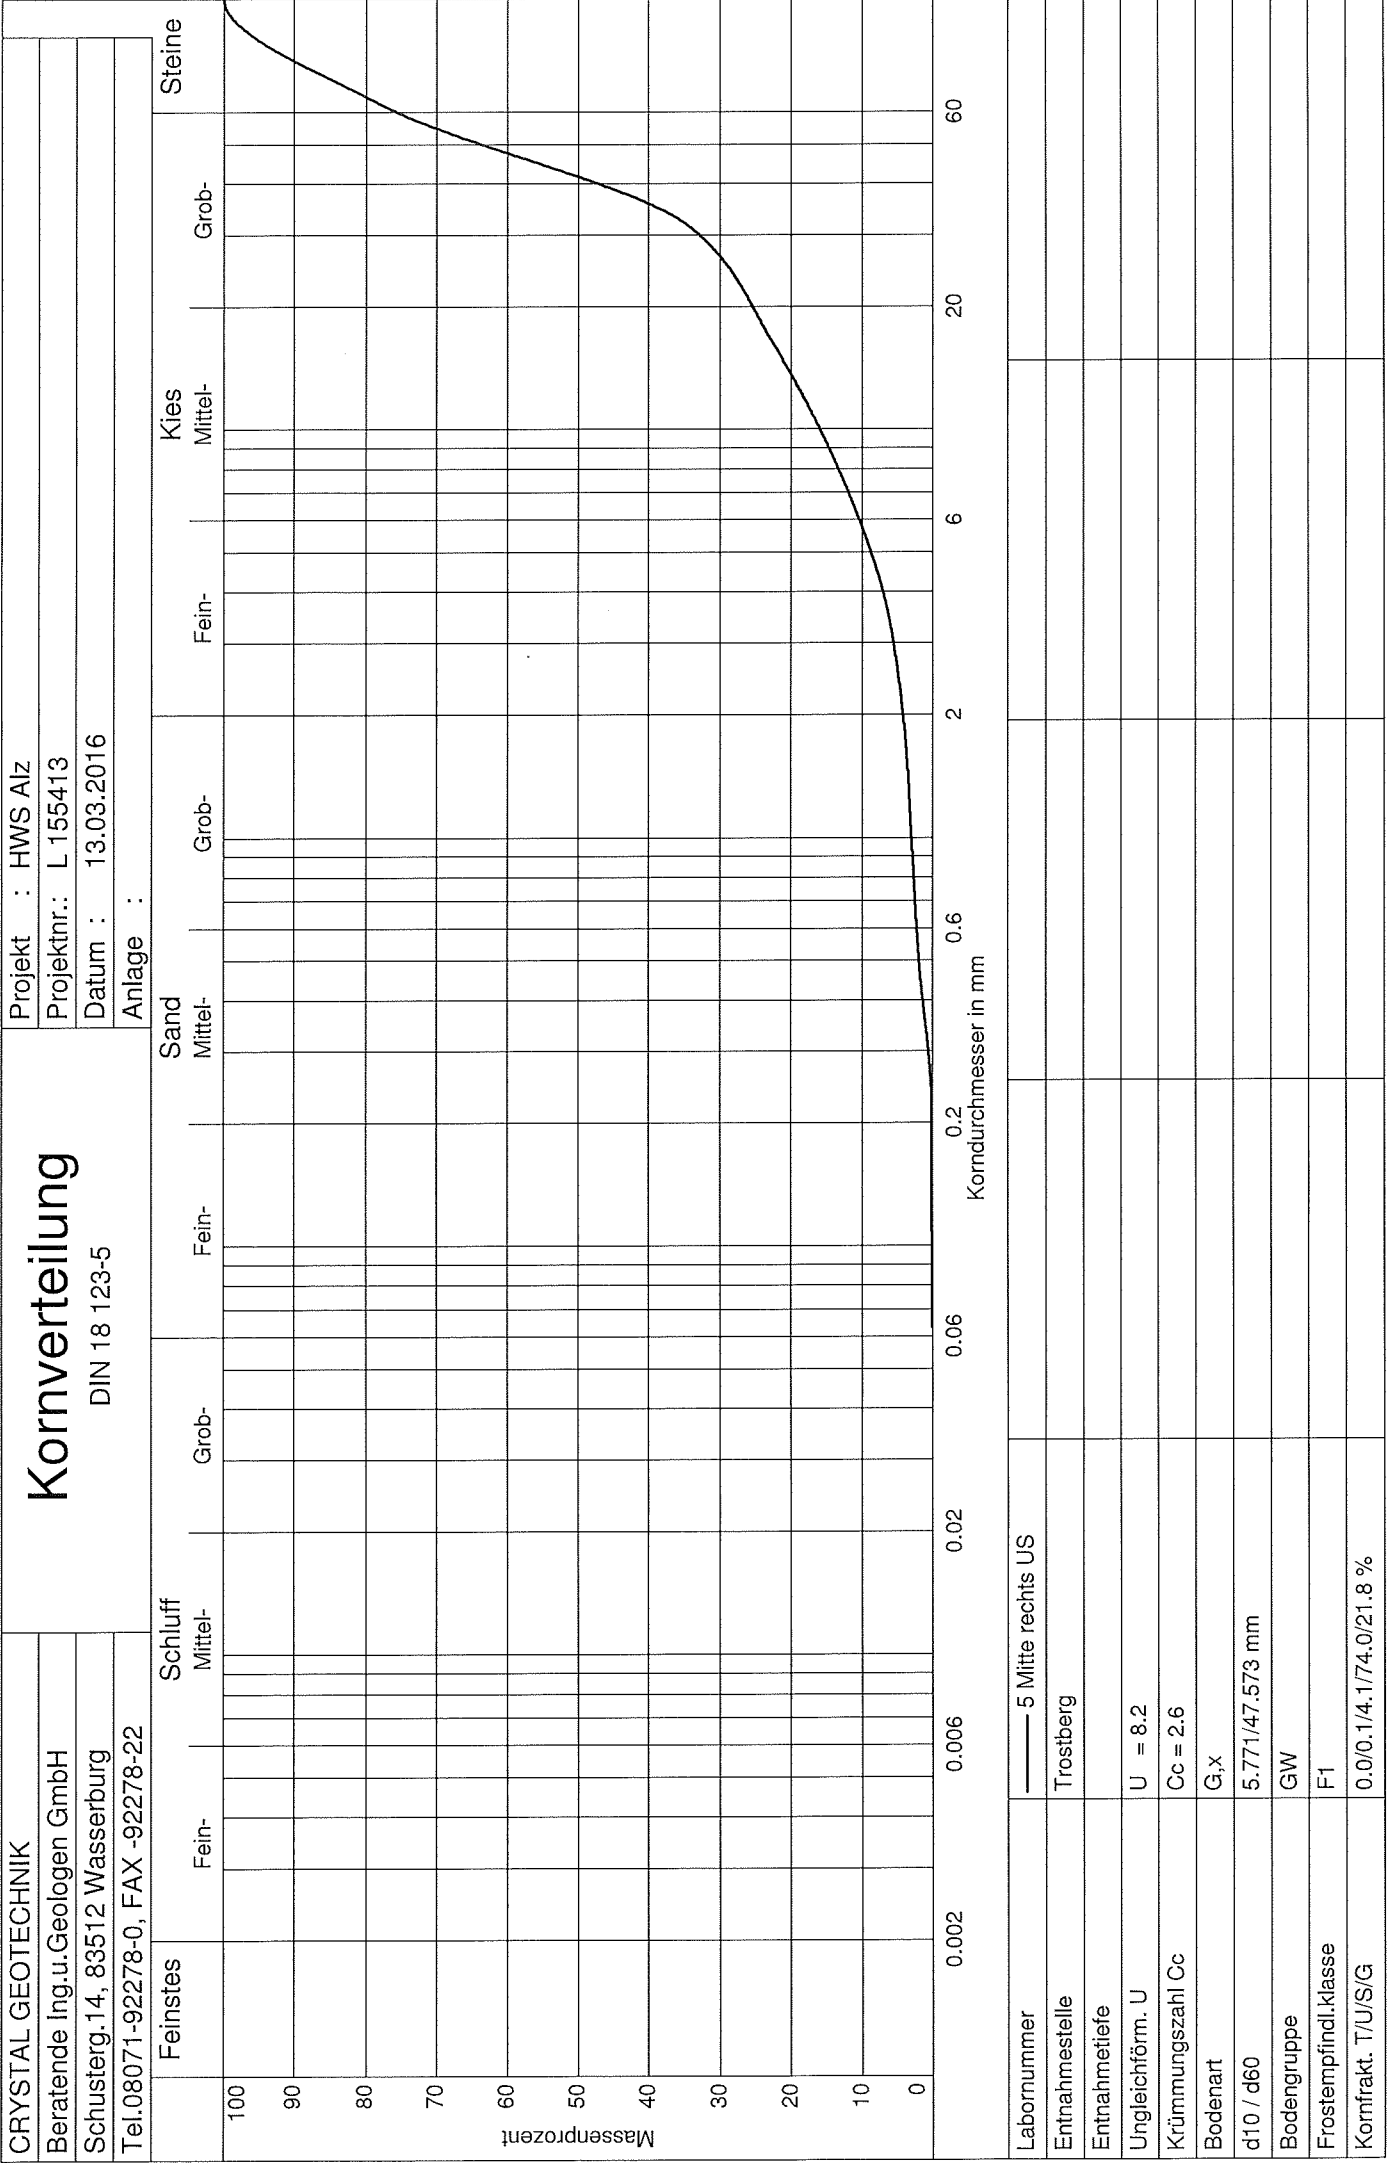


CRYSTAL GEOTECHNIK	Projekt : HWS Alz
Beratende Ing.u.Geologen GmbH	Projektnr.: L 155413
Schusterg.14, 83512 Wasserburg	Datum : 13.03.2016
Tel.08071-50051, FAX -40133	Anlage :

KORNVERTEILUNG

5 Mitte rechts US

Entnahmestelle: Trostberg
Entnahmetiefe:

SIEBUNG					
Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]	Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]
0.000	0.1	0.0			
0.063	0.1	0.1	2.000	2.8	4.2
0.125	0.1	0.2	4.000	6.3	7.0
0.250	1.7	0.3	8.000	9.0	13.4
0.500	1.0	2.0	16.0	12.0	22.4
1.000	1.2	3.0	31.5	43.8	34.4
			63.0	21.8	78.2

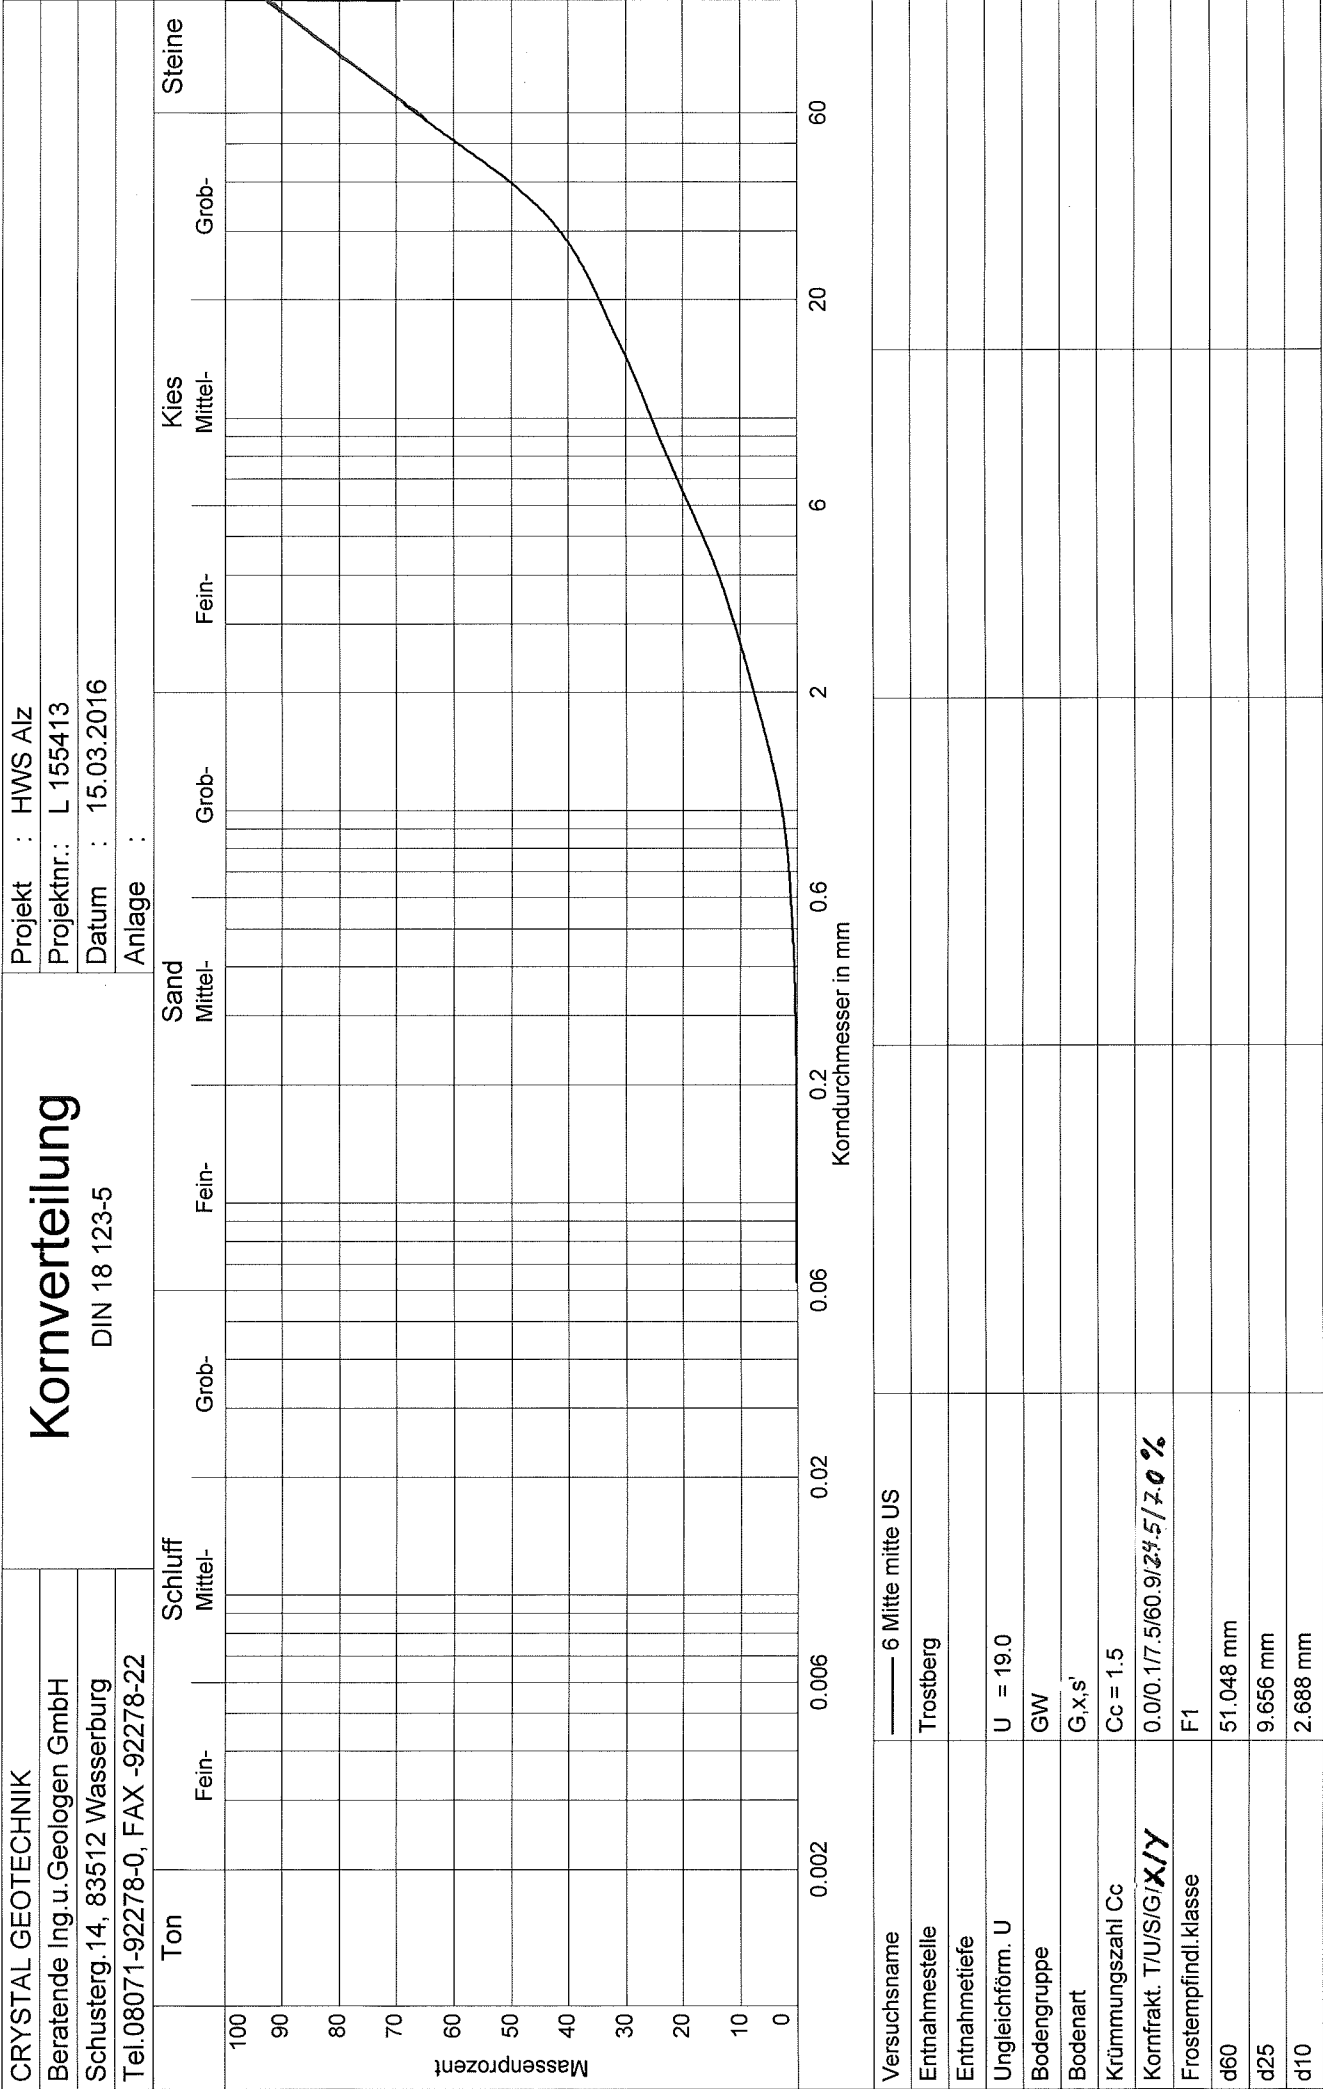


CRYSTAL GEOTECHNIK	Projekt : HWS Alz
Beratende Ing.u.Geologen GmbH	Projektnr.: L 155413
Schusterg.14, 83512 Wasserburg	Datum : 15.03.2016
Tel.08071-50051, FAX -40133	Anlage :

KORNVERTEILUNG

6 Mitte mitte US

Entnahmestelle: Trostberg
Entnahmetiefe:

SIEBUNG					
Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]	Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]
0.000	0.1	0.0			
0.063	0.0	0.1	4.000	8.9	13.8
0.125	0.1	0.1	8.000	8.8	22.7
0.250	0.6	0.2	16.0	11.2	31.5
0.500	1.9	0.9	31.5	25.8	42.7
1.000	4.9	2.7	63.0	24.5	68.5
2.000	6.2	7.6	200.0	7.0	93.0

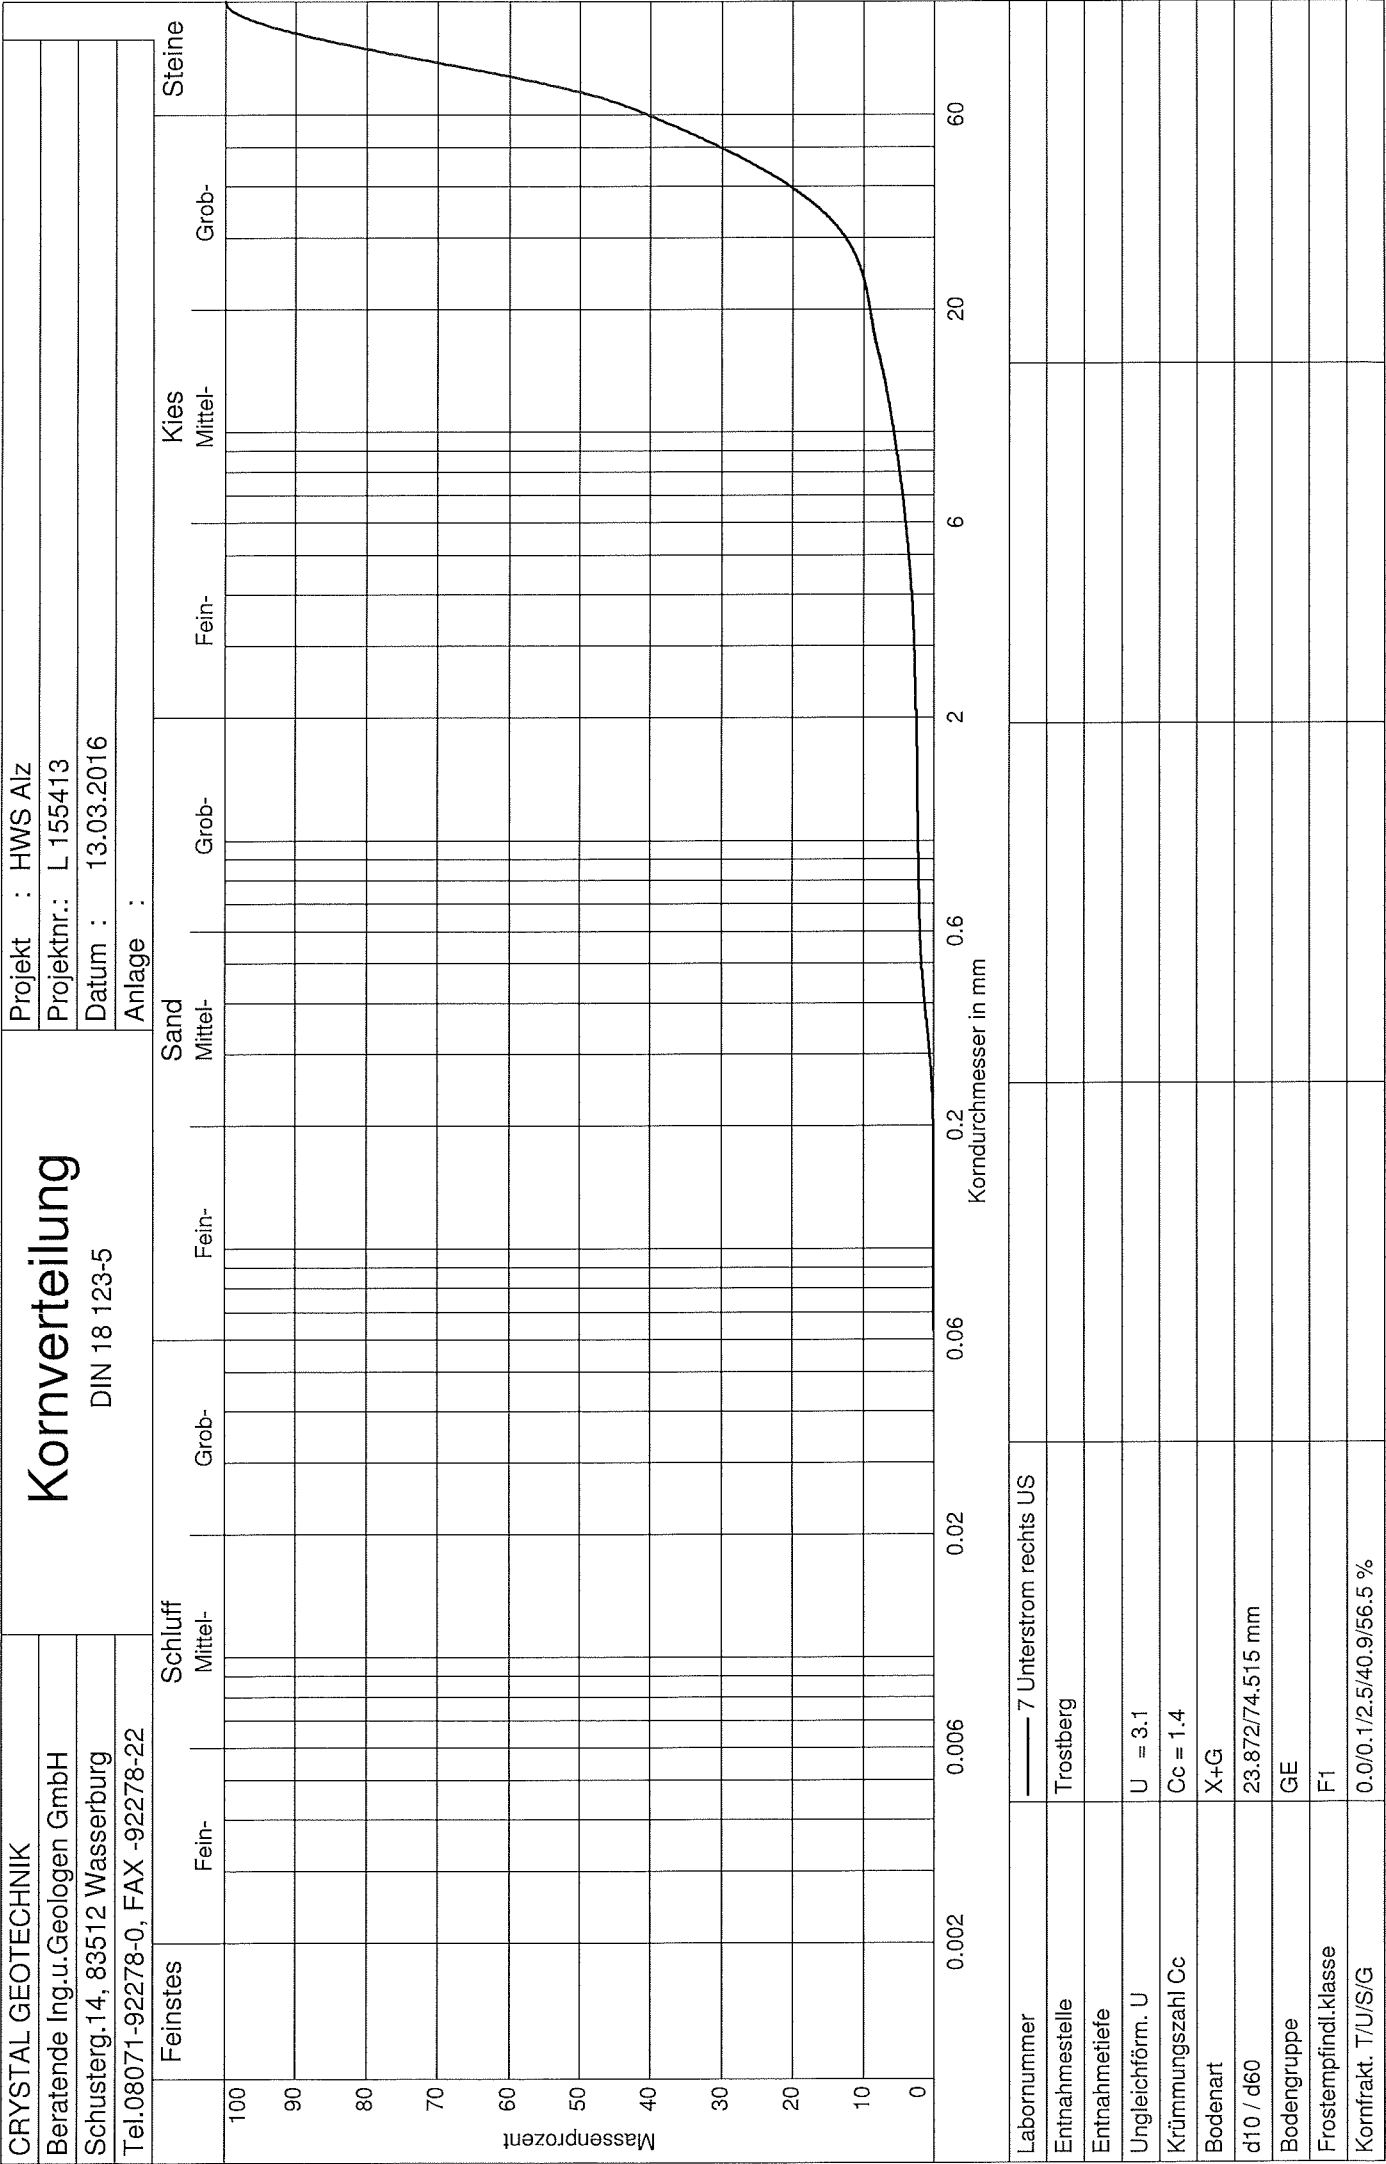

CRYSTAL GEOTECHNIK	Projekt : HWS Alz
Beratende Ing.u.Geologen GmbH	Projektnr.: L 155413
Schusterg.14, 83512 Wasserburg	Datum : 13.03.2016
Tel.08071-50051, FAX -40133	Anlage :


KORNVERTEILUNG

7 Unterstrom rechts US

Entnahmestelle: Trostberg

Entnahmetiefe:

SIEBUNG					
Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]	Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]
0.000	0.1	0.0			
0.063	0.0	0.1	2.000	0.6	2.6
0.125	0.2	0.1	4.000	1.7	3.2
0.250	1.5	0.3	8.000	3.1	4.9
0.500	0.5	1.8	16.0	5.5	8.0
1.000	0.3	2.3	31.5	30.0	13.5
			63.0	56.5	43.5

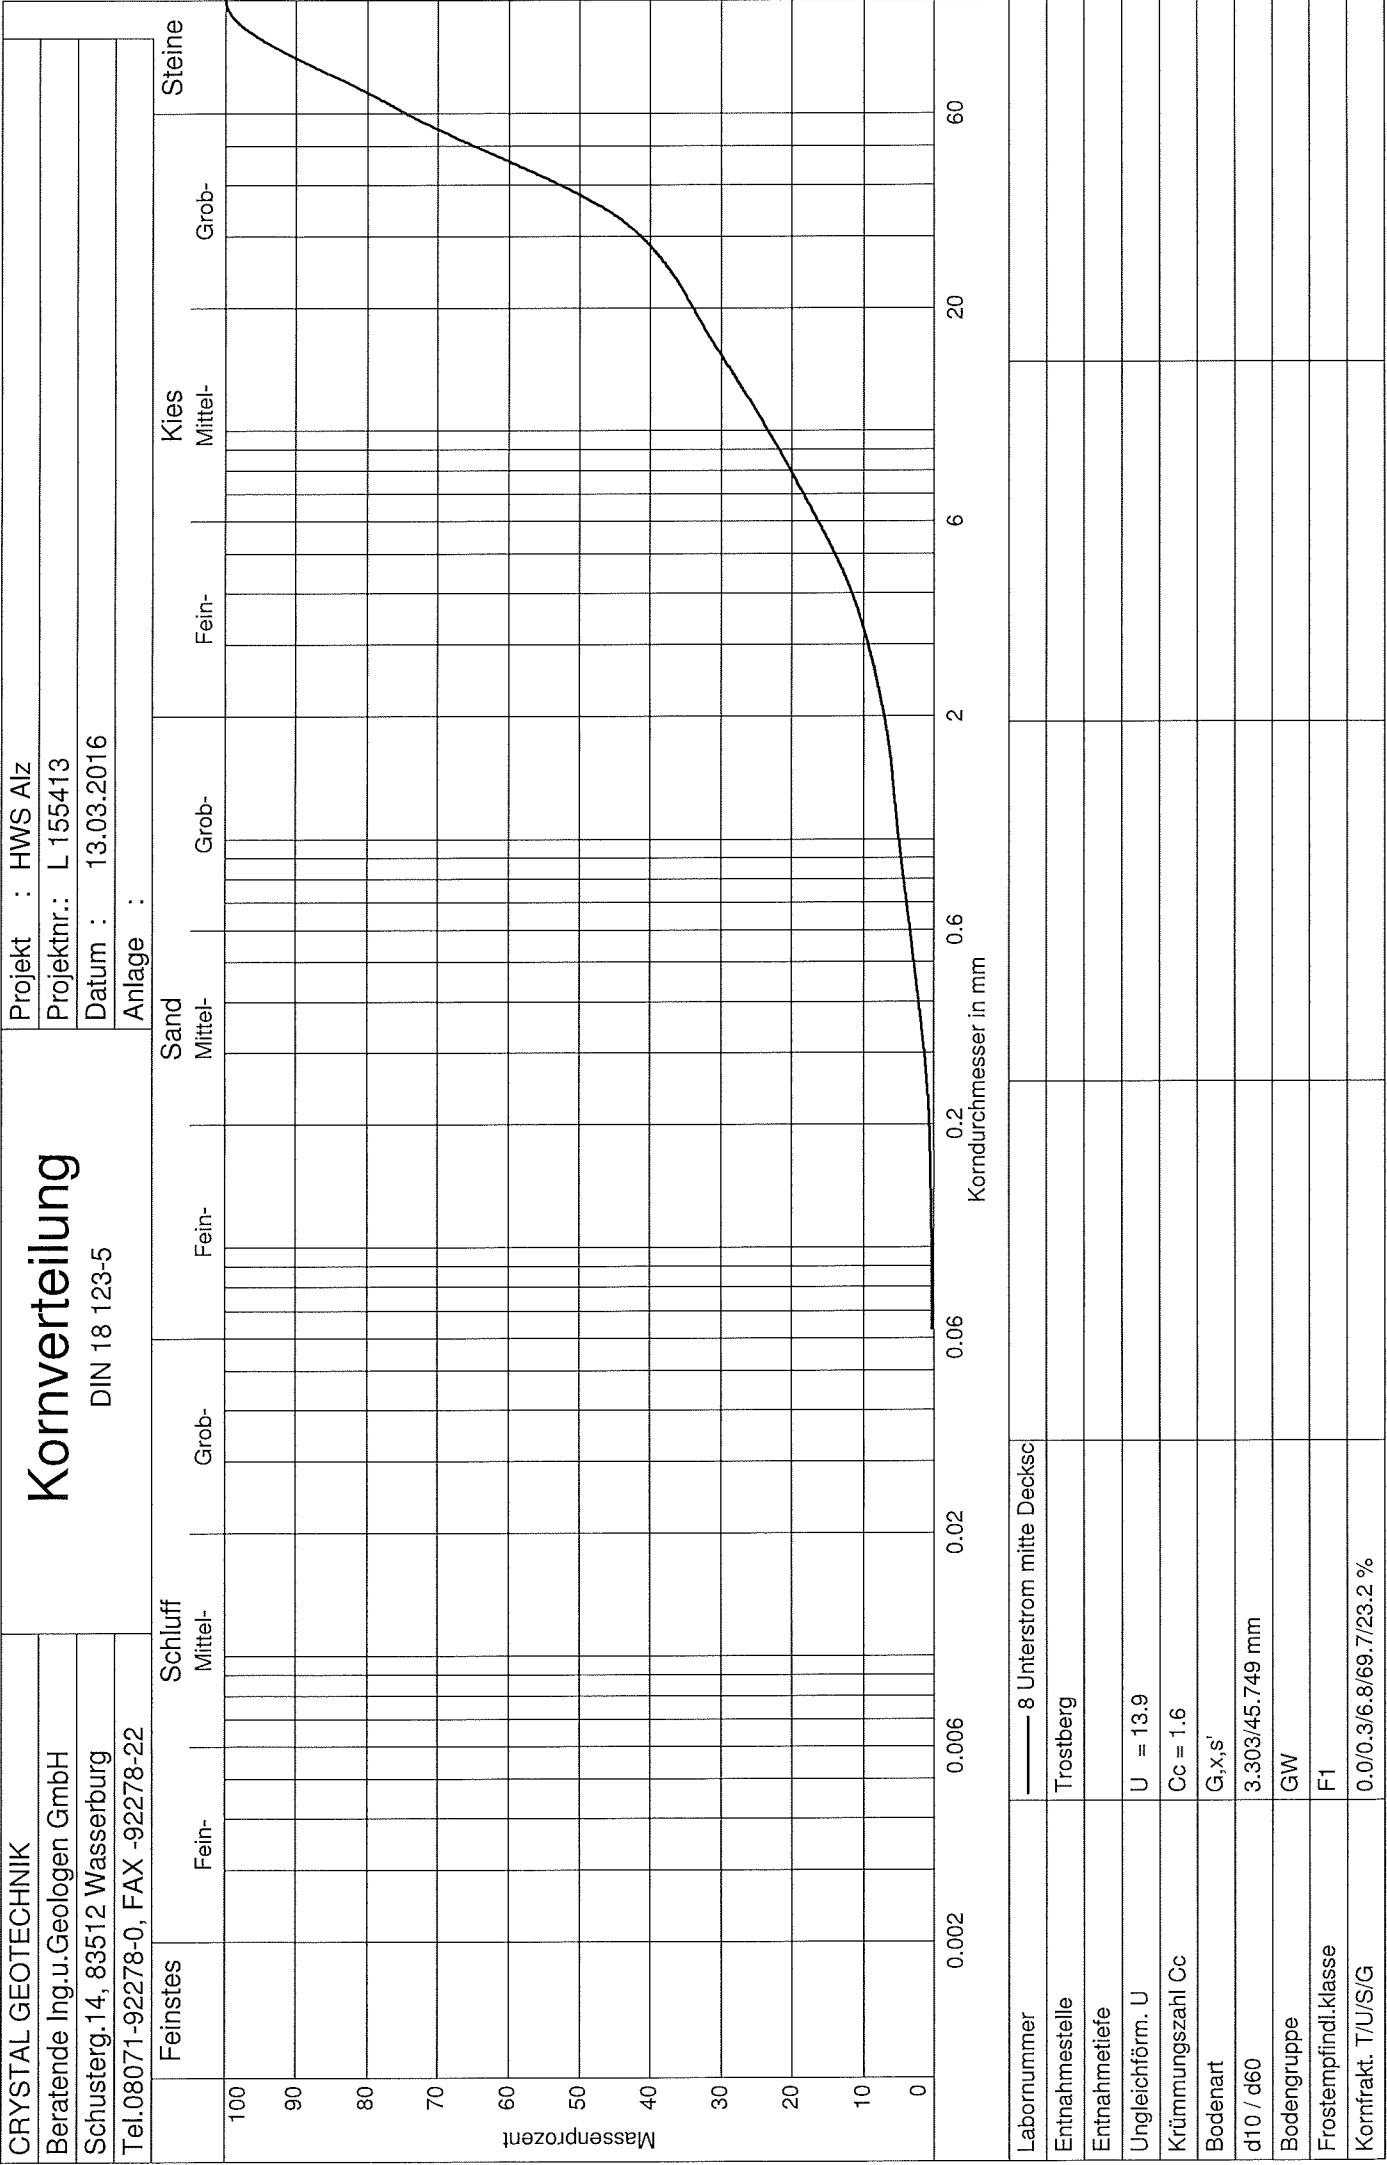

CRYSTAL GEOTECHNIK	Projekt : HWS Alz
Beratende Ing.u.Geologen GmbH	Projektnr.: L 155413
Schusterg.14, 83512 Wasserburg	Datum : 13.03.2016
Tel.08071-50051, FAX -40133	Anlage :


KORNVERTEILUNG

8 Unterstrom mitte Deckschicht

Entnahmestelle: Trostberg

Entnahmetiefe:

SIEBUNG					
Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]	Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]
0.000	0.3	0.0			
0.063	0.1	0.3	2.000	4.5	7.1
0.125	0.6	0.4	4.000	8.6	11.6
0.250	1.9	1.0	8.000	10.5	20.2
0.500	2.2	2.9	16.0	12.1	30.7
1.000	2.0	5.0	31.5	34.0	42.8
			63.0	23.2	76.8

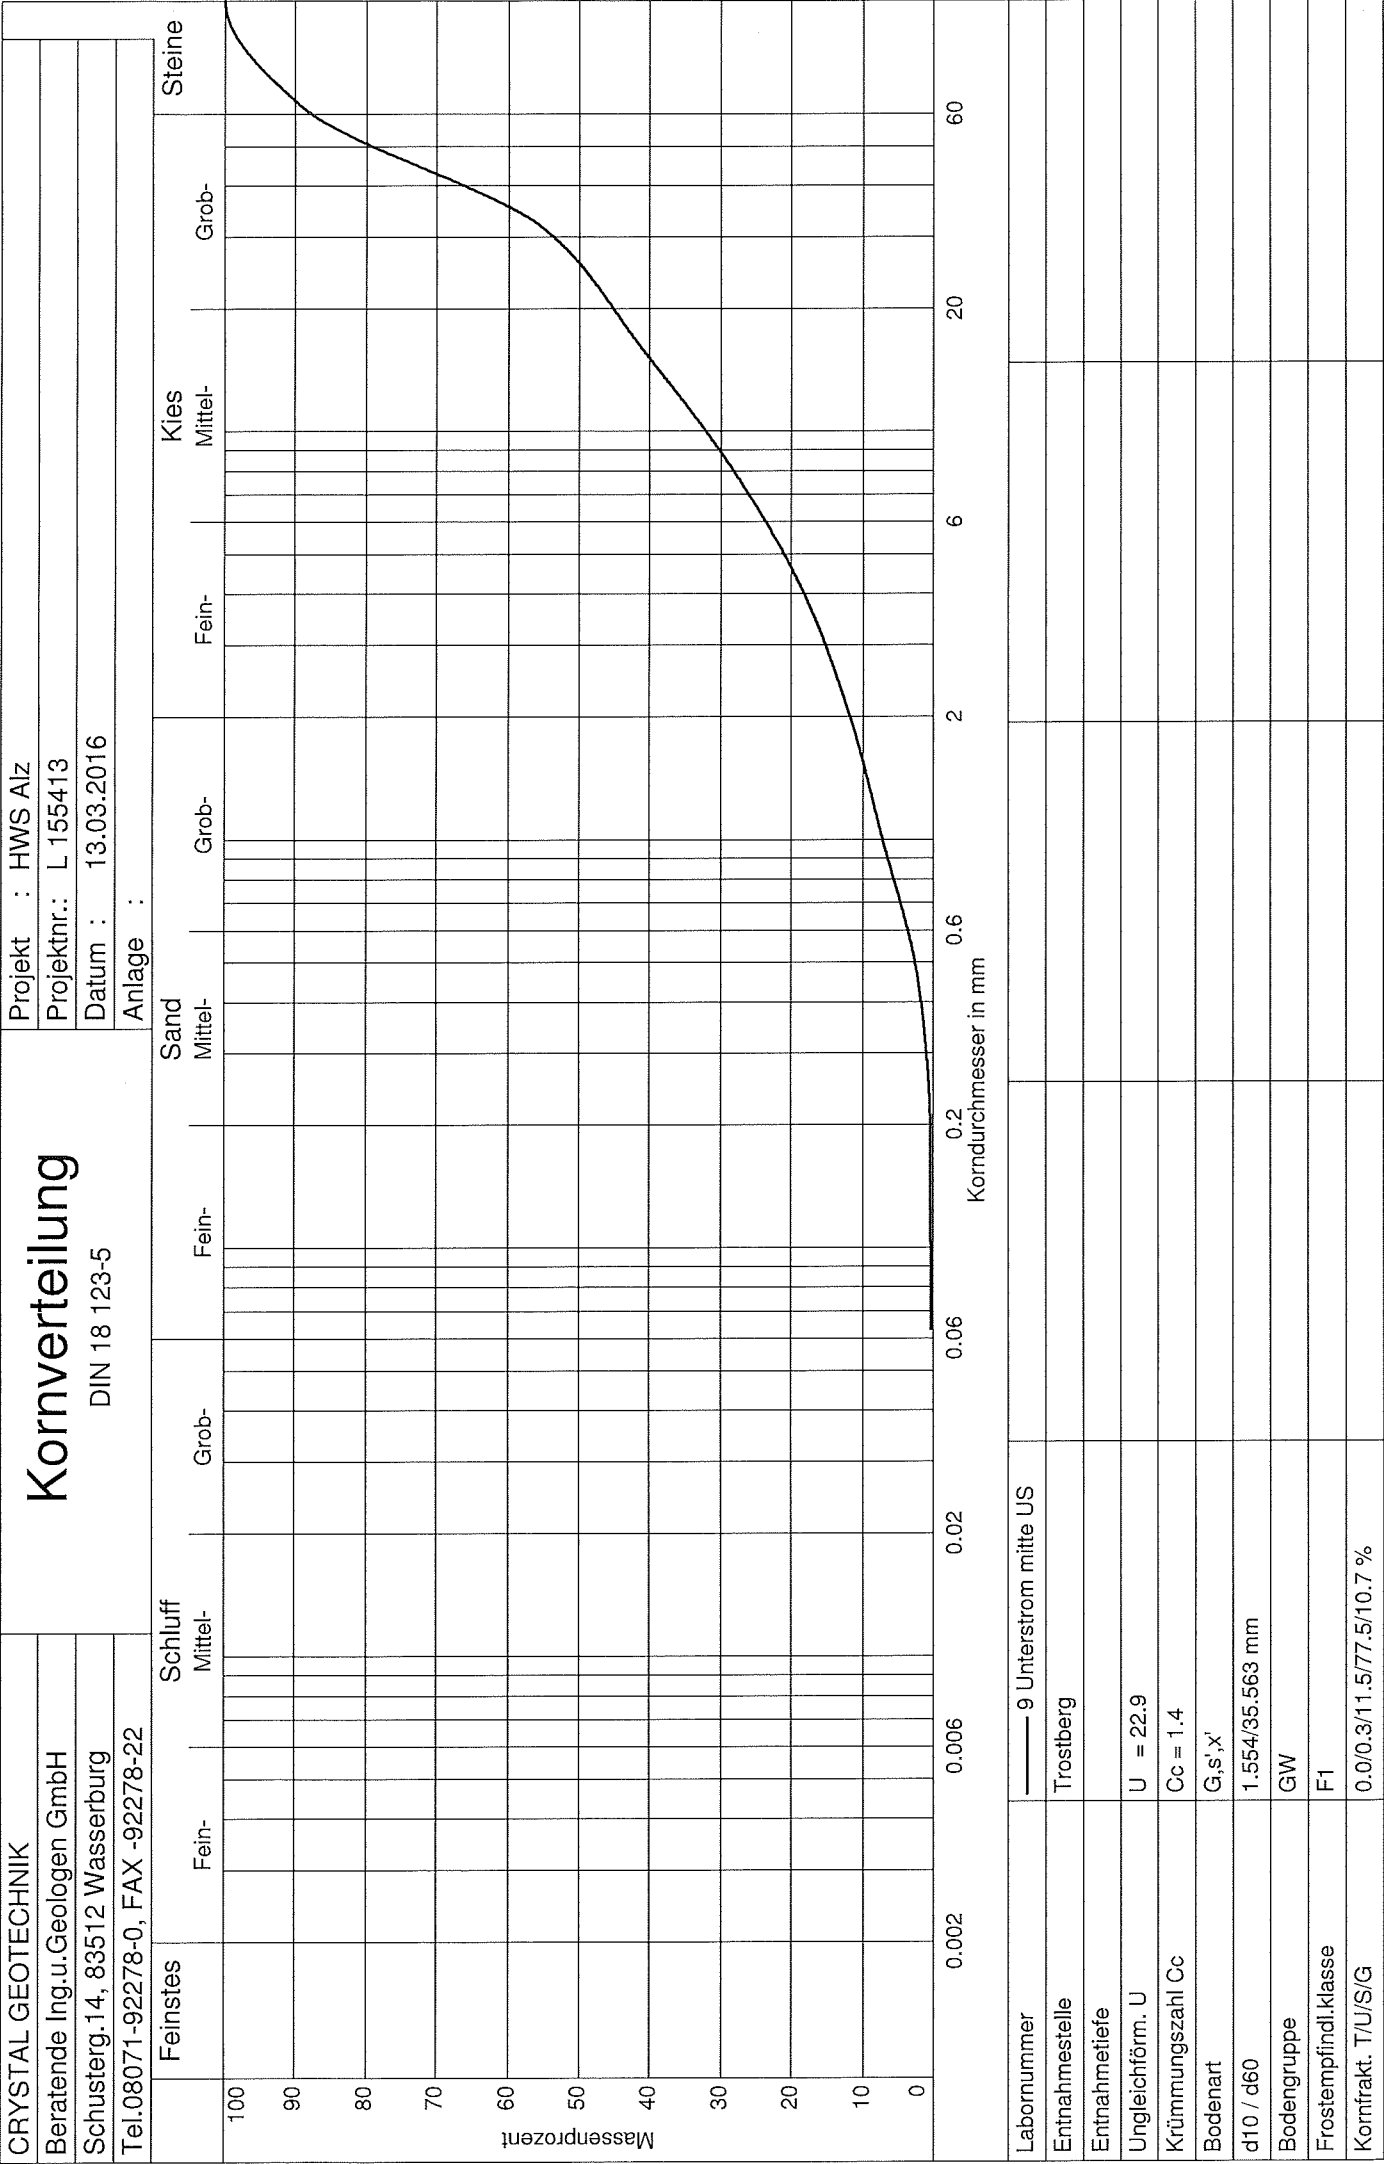

CRYSTAL GEOTECHNIK	Projekt : HWS Alz
Beratende Ing.u.Geologen GmbH	Projektnr.: L 155413
Schusterg.14, 83512 Wasserburg	Datum : 13.03.2016
Tel.08071-50051, FAX -40133	Anlage :


KORNVERTEILUNG

9 Unterstrom mitte US

Entnahmestelle: Trostberg

Entnahmetiefe:

SIEBUNG					
Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]	Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]
0.000	0.3	0.0			
0.063	0.1	0.3	2.000	6.4	11.8
0.125	0.2	0.4	4.000	10.0	18.2
0.250	2.0	0.7	8.000	13.0	28.2
0.500	4.6	2.6	16.0	14.0	41.2
1.000	4.6	7.2	31.5	34.1	55.2
			63.0	10.7	89.3

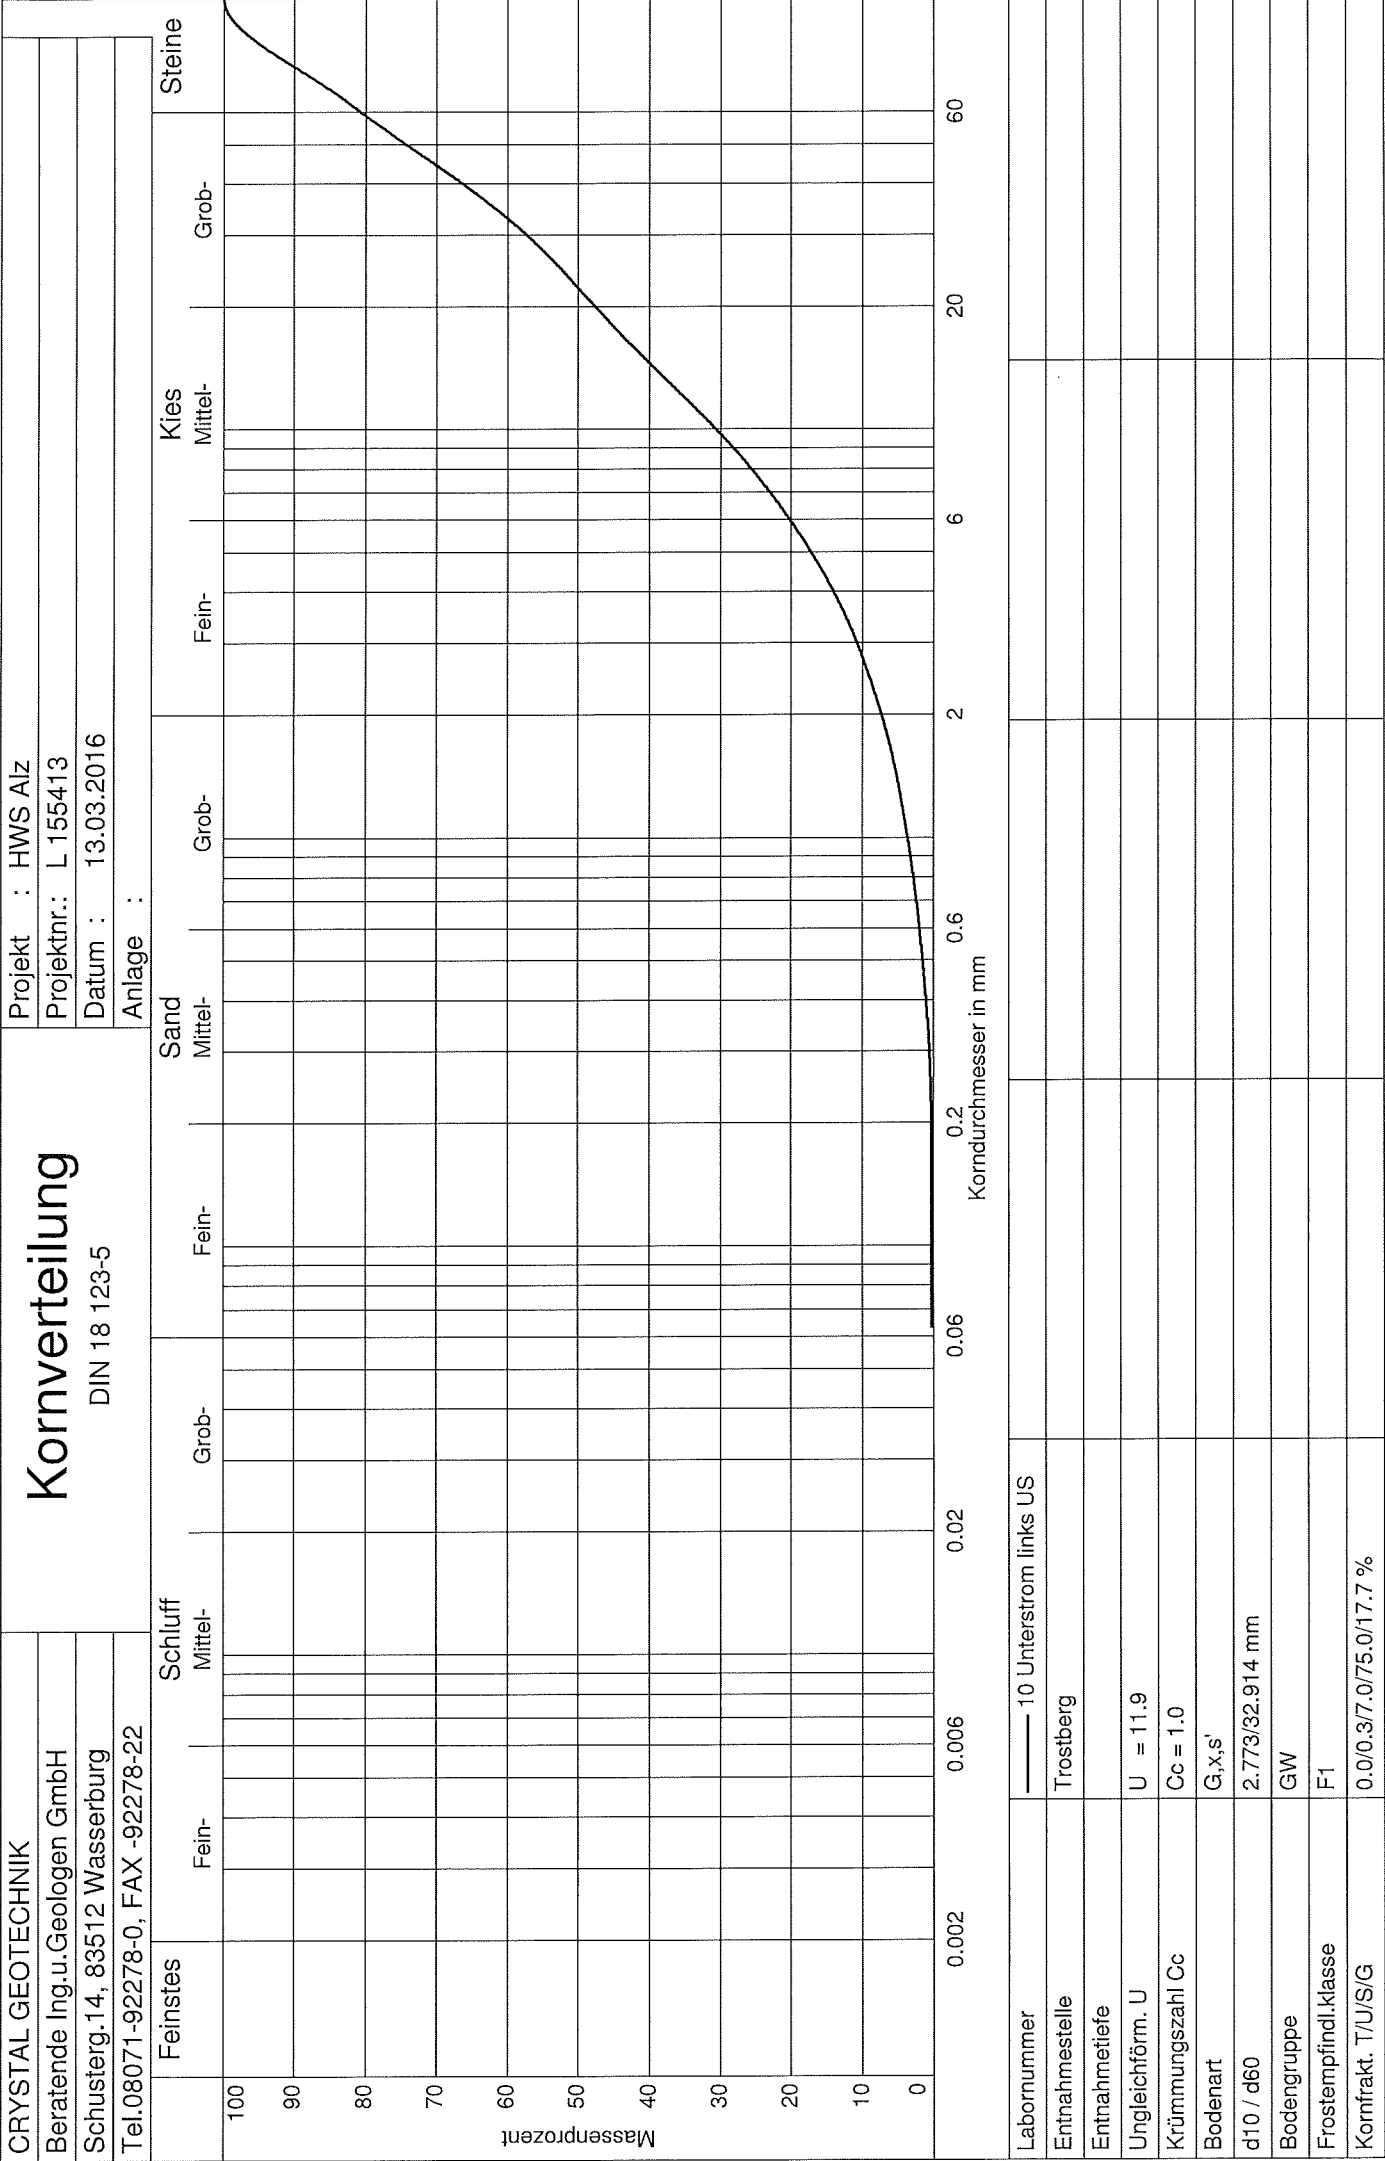

CRYSTAL GEOTECHNIK	Projekt : HWS Alz
Beratende Ing.u.Geologen GmbH	Projektnr.: L 155413
Schusterg.14, 83512 Wasserburg	Datum : 13.03.2016
Tel.08071-50051, FAX -40133	Anlage :

KORNVERTEILUNG

10 Unterstrom links US

Entnahmestelle: Trostberg

Entnahmetiefe:

SIEBUNG					
Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]	Durchmesser [mm]	Siebrückstand [%]	Siebdurchgang [%]
0.000	0.3	0.0			
0.063	0.1	0.3	2.000	6.7	7.3
0.125	0.1	0.3	4.000	11.6	14.0
0.250	1.1	0.4	8.000	16.8	25.6
0.500	2.1	1.5	16.0	16.2	42.5
1.000	3.6	3.7	31.5	23.6	58.7
			63.0	17.7	82.3